

Radio Frequency Safety Survey Report Prediction (RFSSRP) Prepared For:



Site Name: University Park Water Tower FA#: N/A USID: 186384 Site ID: DXL06747 Address: 3533 East Northwest Parkway Dallas, TX 75225 Dallas County: Latitude: N32-51-54.00 Longitude: W96-47-25.20

Additional Site Information

M-RFSC Name: Site Structure Type:

Silvia Davis Water Tank



Report Information

Report Writer: Jeremy Faille Report Generated Date: March 29, 2018

Compliance Statement

AT&T Mobility will be compliant when the remediation recommended in Section 5 or other appropriate remediation determined by AT&T Mobility is implemented.



Table of Contents

1	General Summary	
	1.1 Site Summary	. 3
2	Site Scale Map	.4
3	Antenna Inventory	. 6
4	Predicted Emission Levels and Discussion	.7
	4.1 Predictive AT&T Mobility's RF Contribution Only on the Site	. 8
	4.2 Predictive RF Contribution from All Sources at Ground Level	12
5	Statement of Compliance	13
	5.1 Statement of AT&T Mobility Compliance	13
	5.2 Compliance Requirement Diagram	14
6	Appendix A	15
	6.1 Technical Framework	
7	Appendix B	19
	7.1 Qualifications of Waterford Consultants, LLC	19
8	Appendix C	20
	8.1 RoofMaster [™]	20
9	Appendix D	21
	9.1 Statement of Limiting Conditions	




1 General Summary

1.1 Site Summary

P	· · · · · · · · · · · · · · · · · · ·
Existing RF Sign(s) at Access Point(s)	None
Existing RF Sign(s) at AT&T Mobility Sectors	Alpha: None
	Beta: None
	Gamma: None
Existing Barriers at AT&T Mobility Sectors	None
Max Predictive Spatial Average MPE% &	1359.3945% in front of antenna #2
Location on Site (General Public)	
Max Predictive Spatial Average MPE% at	0.2427% on ground level
Walkable Surface (General Public)	
Max Predictive Spatial Average MPE% at	0.2427% MPE
Ground (General Public)	



2 Site Scale Map

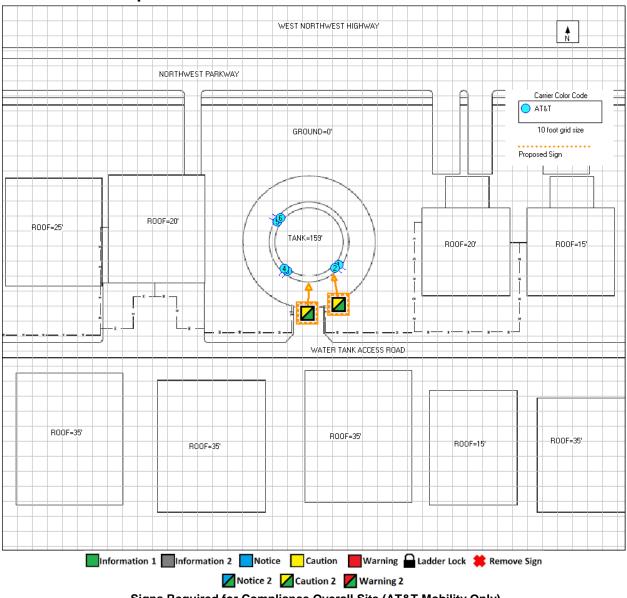





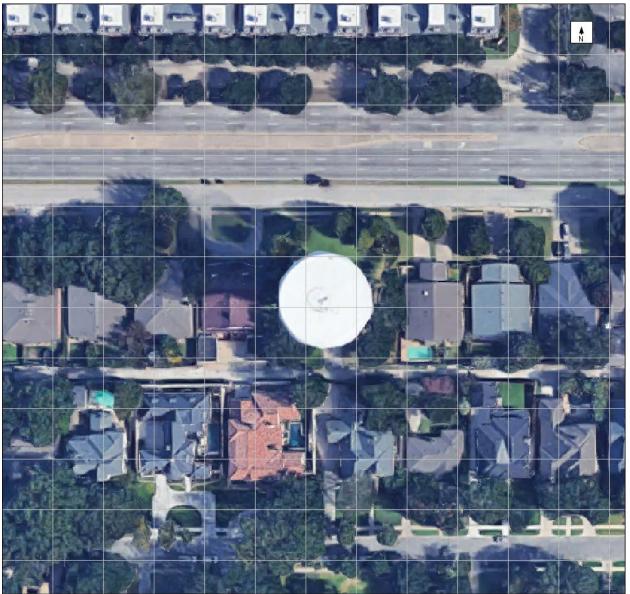


Image to show distance to surrounding buildings 50' Grid



3 Antenna Inventory

																Antenna	Antenna
							Horizontal	Antenna								Bottom Tip	Bottom Tip
							Beam	Length/	Antenna				Total			Height -	Height -
		Antenna			Frequency	Az	width	Aperture	Gain	GSM	LTE	UMTS	ERP	Х	Υ	Ground	Tank Level
Ant #	Operator	Make	Antenna Model	Туре	(MHz)	(deg)	(deg)	(ft)	(dBd)	Radios	Radios	Radios	(watts)	(ft)	(ft)	Level (0ft)	(159ft)
1	AT&T	CCI	HPA-45R-BUU-H6-00DT	Panel	850	128	44	6.0	13.25	0	1	0	2536	194	245	72.0	-87.0
2	AT&T	CCI	HPA-45R-BUU-H6-00DT	Panel	1900	128	47	6.0	15.85	0	1	0	6151	196	243	72.0	-87.0
3	AT&T	CCI	HPA-45R-BUU-H6-00DT	Panel	850	215	44	6.0	13.25	0	1	0	2536	228	241	72.0	-87.0
4	AT&T	CCI	HPA-45R-BUU-H6-00DT	Panel	1900	215	47	6.0	15.85	0	1	0	6151	230	243	72.0	-87.0
5	AT&T	CCI	HPA-45R-BUU-H6-00DT	Panel	850	292	44	6.0	13.25	0	1	0	2536	235	274	72.0	-87.0
6	AT&T	CCI	HPA-45R-BUU-H6-00DT	Panel	1900	292	47	6.0	15.85	0	1	0	6151	233	277	72.0	-87.0

Note: Waterford Consultants, LLC has assumed transmission parameters for Unknown RF emitters based on similar installations found at other radio communications sites. Generic antenna models have been used where existing antenna part numbers or radiation patterns are not available. The frequencies presented in this table may have been assumed in order to represent the approximate band of operation and to support a worst-case calculation of power density.

AT&T Proprietary (Internal use only). Not for use or disclosure outside the AT&T companies, except under written agreement. ©2017 AT&T Intellectual property. All rights reserved.




4 Predicted Emission Levels and Discussion

The following plots show the spatial average predicted power density levels in the reference plane indicated as a percentage of the General Public Limits. Please note that 100% of the General Public Limits corresponds to 20% of the Occupational Limits.


The reference plane for the plot is the roof level, as indicated in the caption. For example, "Avg 10 to 16 Feet" refers to the spatial average predicted power density level between 10 and 16 feet above the main level. Plots are produced for each accessible level. Levels that are not accessible will not be shown. Only accessible areas in a plot are relevant. Areas not accessible or in free space, off the edge of a roof or equipment penthouse, do not affect compliance.



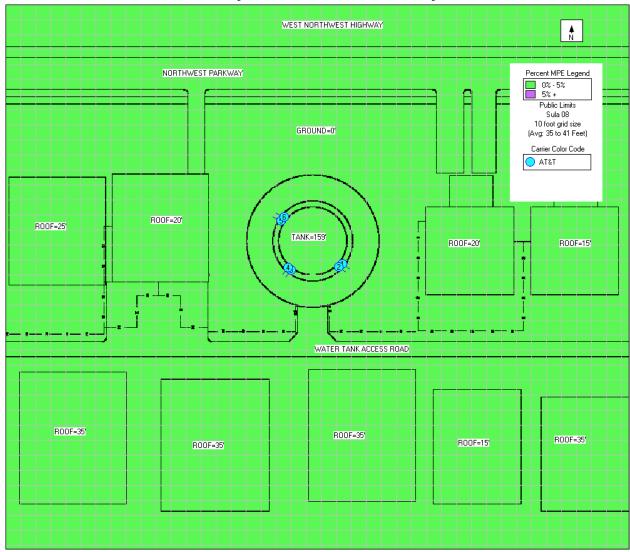


4.1 Predictive AT&T Mobility's RF Contribution Only on the Site

The reference plane for the plot is the Roof level 35'.

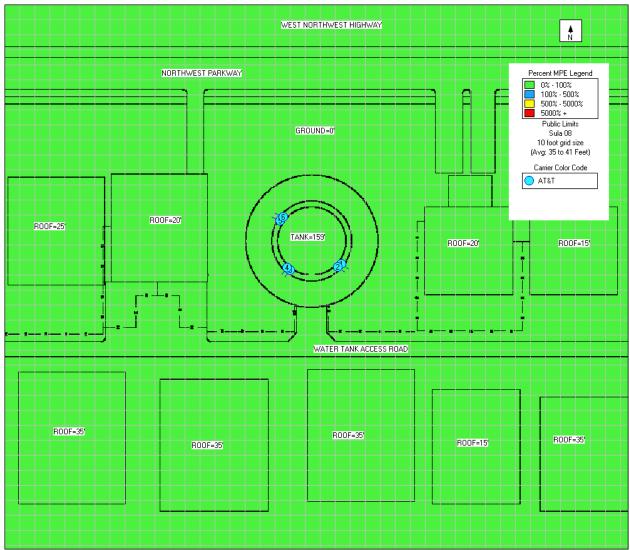


The reference plane for the plot is the Roof level 35'.

WATERFORD

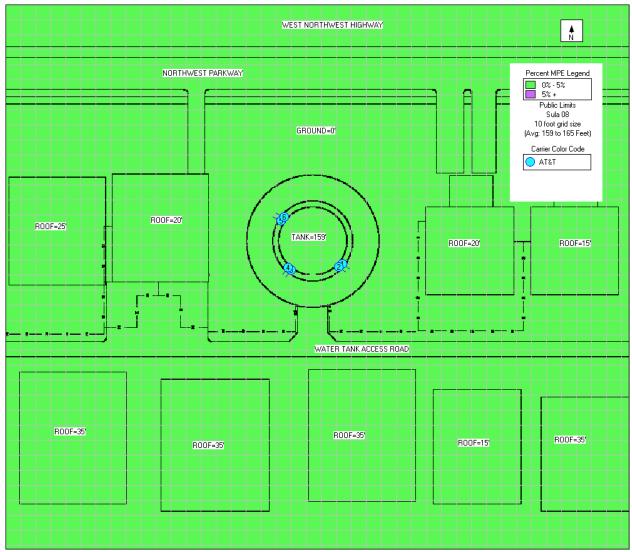


The reference plane for the plot is the Tank level 159'.


WATERFORD

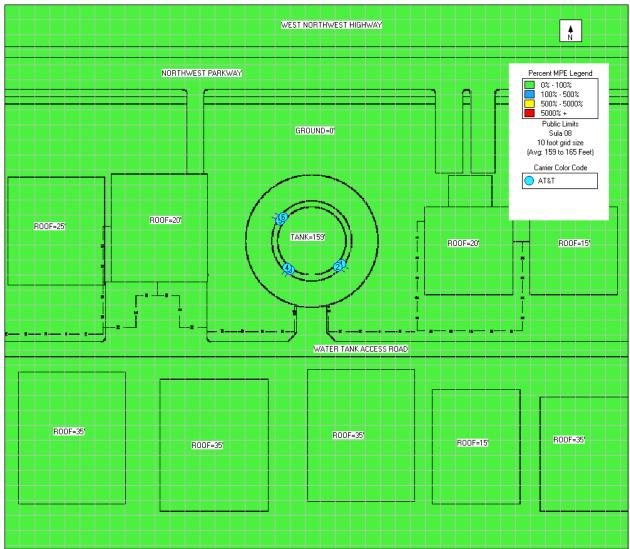

The reference plane for the plot is the Tank level 159'.

WATERFORD

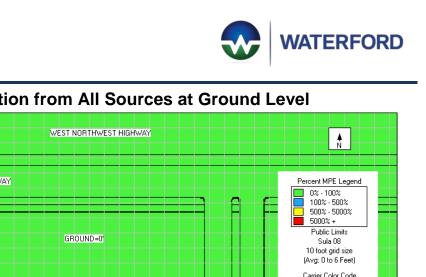

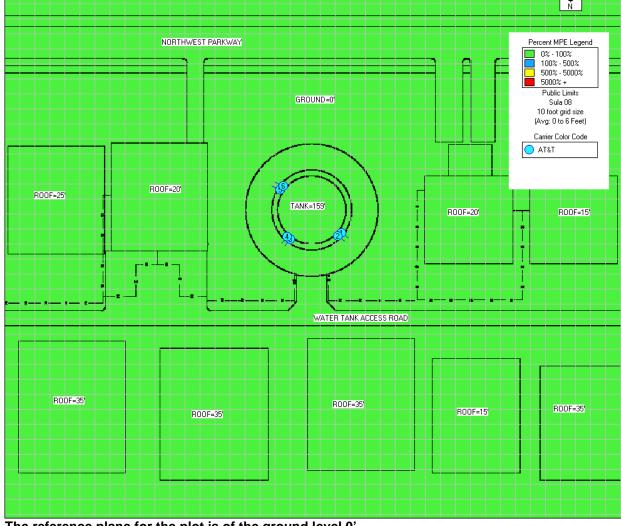

4.2 Predictive RF Contribution from All Sources at Ground Level

The reference plane for the plot is of the ground level 0'.




5 Statement of Compliance

5.1 Statement of AT&T Mobility Compliance

At the time of our audit, AT&T Mobility is required to take action to comply with FCC Radiofrequency Radiation Exposure Limits.





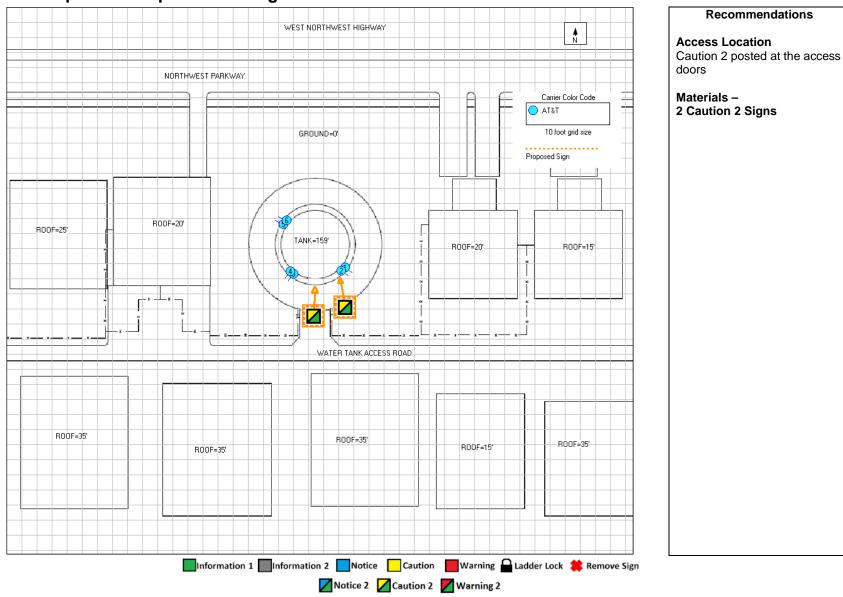

Page 14

RF-18-0020

AT&T Proprietary (Internal use only). Not for use or disclosure outside the AT&T companies, except under written agreement. ©2017 AT&T Intellectual property. All rights reserved.



6 Appendix A

6.1 Technical Framework

The FCC requires licensees to ensure that persons are not exposed to radiofrequency electromagnetic energy power densities in excess of the applicable MPE (Maximum Permissible Exposure) limits. These rules apply to both Occupational Personnel and the General Population. Applicable FCC rules are found at 47 C.F.R. §§ 1.1307(b)(3) and 1.1310. The FCC rules define two tiers of permissible exposure differentiated by the situation in which the exposure takes place and/or the status of the individuals who are subject to exposure.

General Population / uncontrolled exposure limits apply to those situations in which persons may not be aware of the presence of electromagnetic energy, where exposure is not employment-related, or where persons cannot exercise control over their exposure.

Occupational / controlled exposure limits apply to situations in which persons are exposed as a consequence of their employment, have been made fully aware of the potential for exposure, and can exercise control over their exposure.

Maximum Permissible Exposure ("MPE") is defined in OET 65 as being 100% of the exposure limits for the situation or tier of permissible exposure. These limits are listed as follows:

Electric	Magnatia	-	· · ·		
	Magnetic	Power	Averaging Time		
Field	Field (H)	Density (S)	E ² , H ² or S		
Strength (E)	(A/m)	(mW/cm ²)	(minutes)		
(V/m)			· · ·		
614	1.63	(100)*	6		
1842/f	4.89/f	(900/f2)*	6		
61.5	0.163	1.0	6		
		f/300	6		
		5	6		
	Strength (E) V/m) 514 1842/f 51.5 -	Strength (E) (A/m) V/m) 1.63 614 1.63 1842/f 4.89/f 61.5 0.163 - -	Strength (E) (A/m) (mW/cm²) V/m) 1.63 (100)* 614 1.63 (900/f2)* 1842/f 4.89/f (900/f2)* 51.5 0.163 1.0 - f/300		

Limits for Occupational/Controlled Exposure


Limits for General Population/Uncontrolled Exposure

Frequency	Electric	Magnetic	Power	Averaging Time					
Range (MHz)	Field	Field (H)	Density (S)	E ² , H ² or S					
	Strength (E)	(A/m)	(mW/cm ²)	(minutes)					
	(V/m)			· · · ·					
0.3-1.34	614	1.63	(100)*	30					
1.34-30	842/f	2.19/f	(180/f2)*	30					
30-300	27.5	0.073	0.2	30					
300-1500			f/1500	30					
1500-100,000			1.0	30					

f = frequency in MHz

*Plane-wave equivalent power density



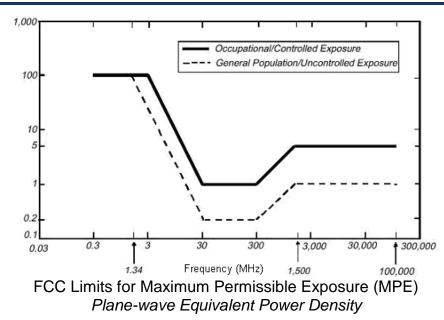

For any area in excess of 100% General Population MPE, access controls with appropriate RF alerting signage must be put in place and maintained to restrict access to authorized personnel. Subject to other site security requirements, Occupational Personnel trained in RF safety and equipped with personal protective equipment designed for safe work in the vicinity of RF may be granted access. Controls such as physical barriers to entry imposed by locked doors, locked passageways, or other access control mechanisms may be supplemented by alarms that alert the individual and notify site management of a breach in access control. Controls may include administrative policies and procedures requiring personal protective equipment (e.g. RF personal monitor), proof of RF training to obtain site access cards, presentation of appropriate RF awareness training certifications to security personnel or other measures designed to prevent uncontrolled access.

RF alerting signs are not necessarily required, and by FCC guidelines, alone do not constitute compliance, posting of the appropriate **NOTICE**, **CAUTION**, or **WARNING** signs at areas of concern is considered good practice. The signs below are examples of signs meeting FCC guidelines.





Power density decreases significantly over a short distance from any antenna. Specifically with respect to directional panel antennas, the design, orientation in azimuth and elevation as documented, reasonably precludes potential to exceed MPE limits at any location other than directly in front of the antenna. Areas in front of the antenna that are restricted by barriers, would require climbing or are otherwise beyond the reach of a standing individual of average height are not considered accessible. Analysis or measurement of instantaneous energy levels is performed for use as proof of compliance with FCC rules and regulations applicable to non-occupational persons, those individuals who are not authorized to access portions of the antenna support structure above ground level. To assess time-average exposure for occupational personnel working within secured areas of the site, on the supporting structure, or in the immediate proximity of the antenna equipment is a separate study requiring detailed ergonomic information.

RF-18-0020



FCC regulations regarding Radiofrequency radiation exposure, expressed in 47 CFR § 1.1310 are further clarified with respect to the value of 5% of exposure limits for the subject transmitters in the following section of 47 CFR § 1.1307 (b):

(3) In general, when the guidelines specified in § 1.1310 are exceeded in an accessible area due to the emissions from multiple fixed transmitters, actions necessary to bring the area into compliance are the shared responsibility of all licensees whose transmitters produce, at the area in question, power density levels that exceed 5% of the power density exposure limit applicable to their particular transmitter or field strength levels that, when squared, exceed 5% of the square of the electric or magnetic field strength limit applicable to their particular transmitter. Owners of transmitter sites are expected to allow applicants and licensees to take reasonable steps to comply with the requirements contained In § 1.1307(b) and, where feasible, should encourage co-location of transmitters and common solutions for controlling access to areas where the RF exposure limits contained in § 1.1310 might be exceeded.

Following these FCC requirements, predictive modeling has been performed to evaluate power density resulting from client transmitters as a percentage of the power density MPE limit applicable to their transmitters. These results are presented in Section 4.

The site should be routinely inspected and this or a similar report updated with any changes to the RF environment including:

- Adding new antennas
- Removing of any existing antennas
- Change in the radiating power or number of RF emitters

Waterford Consultants, LLC recommends coordinating with all wireless tenants before performing services in front of or near any transmitting antennas. During these activities, it may be appropriate to utilize Lockout/Tagout Procedures as specified in ATT-002-290-078, "RF Exposure: Responsibilities, Procedures & Guidelines" for scheduled outages to eliminate RF hazards during these activities.



7 Appendix B

7.1 Qualifications of Waterford Consultants, LLC

With more than 100 team-years of experience, Waterford Consultants, LLC [Waterford] provides technical consulting services to clients in the Radio Communications and antenna locating industry. Waterford retains professional engineers who are placed in responsible charge of the processes for analysis.

Waterford is familiar with 47 C.F.R. § § 1.1307(b)(3) and 1.1310 along with the general Rules, Regulations and policies of the FCC. Waterford work processes incorporate all specifications of FCC Office of Engineering and Technology, Bulletin 65 ("OET65"), from the website: www.fcc.gov/oet/rfsafety and follow criteria detailed in 47 CFR § 1.1310 "Radiofrequency radiation exposure Limits".

Within the technical and regulatory framework detailed above, Waterford developed tools according to recognized and generally accepted good engineering practices. Permissible exposure limits are band specific, and the Waterford computerized modeling tools correctly calculate permissible exposure based on the band(s) specified in the input data. Only clients and client representatives are authorized to provide input data through the Waterford web portal. In securing that authorization, clients and client representatives attest to the accuracy of all input data.

Waterford Consultants, LLC attests to the accuracy of the engineering calculations computed by those modeling tools. Furthermore, Waterford attests that the results of those engineering calculations are correctly summarized in this report.



8 Appendix C

8.1 RoofMaster™

RoofMaster[™] is the software package that Waterford Consultants, LLC created to model RF environments associated with multiple emitters where the potential exists for human exposure. Based on the computational guidelines set forth in OET Bulletin 65 from the Federal Communications Commission (FCC), RoofMaster[™] considers the operating parameters of specified RF sources to predict the overall Maximum Permissible Exposure possible at a given location. These theoretical results represent worst-case predictions as emitters are assumed to be operating at 100% duty cycle.

From the FCC document:

"The revised OET Bulletin 65 has been prepared to provide assistance in determining whether proposed or existing transmitting facilities, operations or devices comply with limits for human exposure to radiofrequency (RF) fields adopted by the Federal Communications Commission (FCC). The bulletin offers guidelines and suggestions for evaluating compliance."

http://transition.fcc.gov/Bureaus/Engineering_Technology/Documents/bulletins/oet65/oet65.pdf



9 Appendix D

9.1 Statement of Limiting Conditions

Waterford Consultants, LLC has received data pertaining to RF environment provided by the client. Waterford Consultants, LLC will not be responsible for matters of a legal nature that affect the site or property. The property has been analyzed under the premise that it is under responsible ownership and management and our client has the legal right to conduct business at this facility.

Due to the complexity of some wireless sites, Waterford Consultants, LLC has created this report utilizing best industry practices and due diligence. Waterford Consultants, LLC cannot be held accountable or responsible for anomalies or discrepancies due to actual site conditions (i.e., mislabelling of antennas or equipment, inaccessible cable runs, inaccessible antennas or equipment, etc.) or information or data supplied by Wireless Carrier, the site manager, or their affiliates, subcontractors or assigns.

Waterford Consultants, LLC has provided the results of a computer generated model in this MPE Site Compliance Report to show approximate dimensions of the site, and the model results is included to assist the reader of the compliance report to visualize the site area, and to provide supporting documentation for Waterford Consultants, LLC recommendations.

Waterford Consultants, LLC will not be responsible for any existing conditions or for any engineering or testing that might be required to discover whether adverse safety conditions exist. Because Waterford Consultants, LLC is not an expert in the field of mechanical engineering or building maintenance, this MPE Site Compliance Report must not be considered a structural or physical engineering report.

Waterford Consultants, LLC obtained information used in this MPE Site Compliance Report from sources that Waterford Consultants, LLC considers reliable and believes them to be true and correct. Waterford Consultants, LLC does not assume any responsibility for the accuracy of such items that were furnished by other parties.